



圆棒材/六角型材/树脂棒材

圆棒材

材质不锈钢·铝合金·黄铜



型号(1 代码·2 D) — 3 L

JBOA10

— 300

■ 请按步骤①~③选择型号和参数后进行订购。

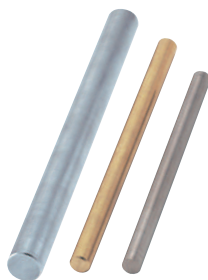


型号区分:

■ 色型式

5 天发货

代码	材质
JBOF	SUS303
JBOS	SUS304
JBOH	SUS316
JBOA	2000系列铝合金
JBOK	5000系列铝合金
JB52A	
JBOG	C3604—LCD(黄铜)



■ L尺寸公差

以上	以下	公差
10	30	±0.2
31	120	±0.3
121	400	±0.5
401	1000	±0.8

■ C尺寸

以上	以下	C
D3	D16	0.5以下
D17	D60	1.0

■ D尺寸公差

型式	JBOF JBOS	JBOH	JBOA	JBOK JB52A JBOG
D				
3				
4				
5				
6				
8				
10				
12	0	0	±0.1	
13	-0.1	-0.1		±0.1
15				
16				
18				
20				
25			±0.4	
30				
50	0	-	-	-
	-0.2			

型号		最小单位 1mm
1 代码	2 D	
JBOF (SUS303)	3	10~ 250
	4	10~ 250
	5	10~ 250
JBOS (SUS304)	6	10~ 500
JBOH (SUS316)	8	10~ 500
	10	10~ 500
JBOA (2000系列铝合金)	12	10~ 750
	13	10~ 750
JBOK (5000系列铝合金)	15	10~ 750
JB52A(D5~12·15~20) (5000系列铝合金)	16	10~ 900
JBOG (C3604—LCD)	18	20~1000
	20	20~1000
	25	20~1000
	30	20~1000
	50	30~1000





型号(1 代码·2 D) — 3 L — (MC·WMC)

JBOF20

— 535 —

MC8

可选加工																																	
	加工一端螺纹	加工两端螺纹																															
代码	MC	WMC																															
技术说明	在一端加工螺纹。 指定方法 MC8 ① $6 \leq D \leq 30$ ① $L \leq M \times 2$ 时变为螺纹通孔。	在两端加工螺纹。 指定方法 WMC12 ① $6 \leq D \leq 30$ ① $L \leq M \times 4$ 时变为螺纹通孔。																															
	<table><tr><th>D</th><th>MC(选择范围)</th></tr><tr><td>6・7</td><td>3</td></tr><tr><td>8・9</td><td>3・4</td></tr><tr><td>10・11</td><td>3・4・5</td></tr><tr><td>12~14</td><td>3・4・5・6</td></tr><tr><td>15~19</td><td>3・4・5・6・8</td></tr><tr><td>20~24</td><td>3・4・5・6・8・10・12</td></tr><tr><td>25~30</td><td>3・4・5・6・8・10・12・16</td></tr></table> ① $L \leq M \times 4$ 时，螺纹底孔可能会贯通。	D	MC(选择范围)	6・7	3	8・9	3・4	10・11	3・4・5	12~14	3・4・5・6	15~19	3・4・5・6・8	20~24	3・4・5・6・8・10・12	25~30	3・4・5・6・8・10・12・16	<table><tr><th>D</th><th>WMC(选择范围)</th></tr><tr><td>6・7</td><td>3</td></tr><tr><td>8・9</td><td>3・4</td></tr><tr><td>10・11</td><td>3・4・5</td></tr><tr><td>12~14</td><td>3・4・5・6</td></tr><tr><td>15~19</td><td>3・4・5・6・8</td></tr><tr><td>20~24</td><td>3・4・5・6・8・10・12</td></tr><tr><td>25~30</td><td>3・4・5・6・8・10・12・16</td></tr></table>	D	WMC(选择范围)	6・7	3	8・9	3・4	10・11	3・4・5	12~14	3・4・5・6	15~19	3・4・5・6・8	20~24	3・4・5・6・8・10・12	25~30
D	MC(选择范围)																																
6・7	3																																
8・9	3・4																																
10・11	3・4・5																																
12~14	3・4・5・6																																
15~19	3・4・5・6・8																																
20~24	3・4・5・6・8・10・12																																
25~30	3・4・5・6・8・10・12・16																																
D	WMC(选择范围)																																
6・7	3																																
8・9	3・4																																
10・11	3・4・5																																
12~14	3・4・5・6																																
15~19	3・4・5・6・8																																
20~24	3・4・5・6・8・10・12																																
25~30	3・4・5・6・8・10・12・16																																

询价④种方式



官网 <http://www.srdfaa.com>
深圳市仕瑞达自动化设备有限公司



全国免费 400-966-3863
客服热线 0755-27926613