

圆棒材

材质S45C·一般结构用钢·SCM435

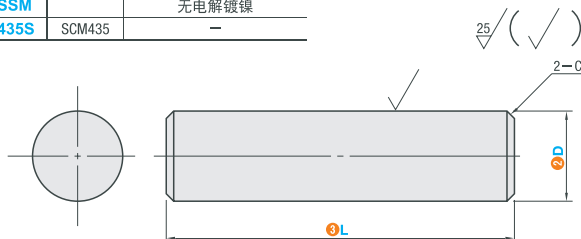
圆棒材/六角型材/树脂棒材

型号(①代码·②D) — ③L
JBOC20 — 300

■请按步骤①~③选择型号和参数后进行订购。

型号区分:
■色型式 5 天发货

代码	材质	表面处理
JBOC	S45C	—
JBOB		发黑
JBOM		无电解镀镍
JBSS	一般结构用钢	—
JBSSB		发黑
JBSSM		无电解镀镍
JB435S	SCM435	—



■C尺寸

以上	以下	C
D3	D16	0.5以下
D17	D60	1.0

■D尺寸公差

以上	以下	公差
3	30	0 -0.1
35	60	0 -0.2

■L尺寸公差



以上	以下	公差
10	30	±0.2
31	120	±0.3
121	400	±0.5
401	1000	±0.8

圆棒材·六角型材
树脂棒材

31

型号		③L 最小单位1mm
①代码	②D	
JBOC (S45C)	3	10~250
	4	10~250
	5	10~250
JBOB (S45C)	6	10~500
	8	10~500
JBOM (S45C 无电解镀镍)	10	10~500
	12	10~750
JBSS (S45C)	13	10~750
	15	10~750
JBSSB (S45C 发黑)	16	10~800
	18	20~800
JBSSM (S45C 无电解镀镍)	20	20~800
	25	20~800
JB435S (D4~20) (SCM435)	30	20~1000
	35	30~1000
	40	30~1000
	50	30~1000

型号(①代码·②D) — ③L — (MC·WMC)
JBOC20 — 535 — MC8

	加工一端螺纹	加工两端螺纹																																
可选加工																																		
代码	MC	WMC																																
技术说明	在一端加工螺纹。 指定方法 MC8 ① 6 ≤ D ≤ 30 ① L ≤ M × 2 时变为螺纹通孔。	在两端加工螺纹。 指定方法 WMC12 ① 6 ≤ D ≤ 30 ① L ≤ M × 4 时变为螺纹通孔。																																
	<table><tr><th>D</th><th>MC(选择范围)</th></tr><tr><td>6・7</td><td>3</td></tr><tr><td>8・9</td><td>3・4</td></tr><tr><td>10・11</td><td>3・4・5</td></tr><tr><td>12~14</td><td>3・4・5・6</td></tr><tr><td>15~19</td><td>3・4・5・6・8</td></tr><tr><td>20~24</td><td>3・4・5・6・8・10・12</td></tr><tr><td>25~30</td><td>3・4・5・6・8・10・12・16</td></tr></table> ① L ≤ M × 4 时, 螺纹底孔可能会贯通。	D	MC(选择范围)	6・7	3	8・9	3・4	10・11	3・4・5	12~14	3・4・5・6	15~19	3・4・5・6・8	20~24	3・4・5・6・8・10・12	25~30	3・4・5・6・8・10・12・16	<table><tr><th>D</th><th>WMC(选择范围)</th></tr><tr><td>6・7</td><td>3</td></tr><tr><td>8・9</td><td>3・4</td></tr><tr><td>10・11</td><td>3・4・5</td></tr><tr><td>12~14</td><td>3・4・5・6</td></tr><tr><td>15~19</td><td>3・4・5・6・8</td></tr><tr><td>20~24</td><td>3・4・5・6・8・10・12</td></tr><tr><td>25~30</td><td>3・4・5・6・8・10・12・16</td></tr></table>	D	WMC(选择范围)	6・7	3	8・9	3・4	10・11	3・4・5	12~14	3・4・5・6	15~19	3・4・5・6・8	20~24	3・4・5・6・8・10・12	25~30	3・4・5・6・8・10・12・16
	D	MC(选择范围)																																
6・7	3																																	
8・9	3・4																																	
10・11	3・4・5																																	
12~14	3・4・5・6																																	
15~19	3・4・5・6・8																																	
20~24	3・4・5・6・8・10・12																																	
25~30	3・4・5・6・8・10・12・16																																	
D	WMC(选择范围)																																	
6・7	3																																	
8・9	3・4																																	
10・11	3・4・5																																	
12~14	3・4・5・6																																	
15~19	3・4・5・6・8																																	
20~24	3・4・5・6・8・10・12																																	
25~30	3・4・5・6・8・10・12・16																																	



邮箱: Service@srdfaa.com



传真: 0755-8957-5523

SRD仕瑞达